




1. After the installation of the Lightburn program and drivers for a CNC machine we connect the computer with the installed program to the CNC machine by means of a USB cable.



2. We open the Windows device manager to check our machine in the Ports (COM & LPT) tab. The device should appear without an exclamation mark, as shown. The port number may be different. In our case it is COM3.

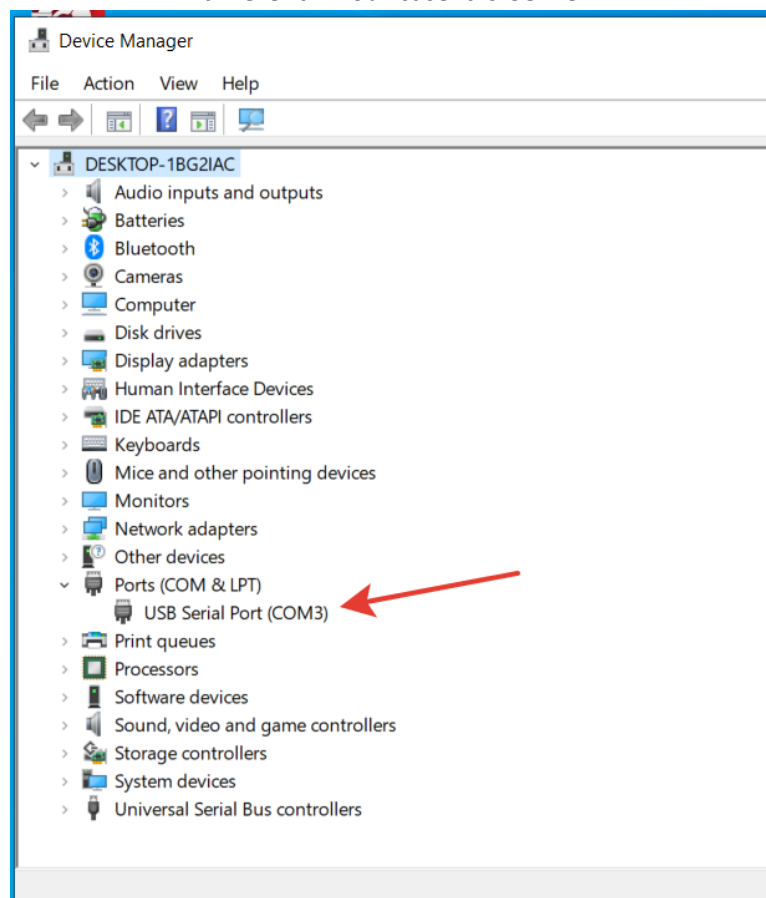

3. If there are several COM ports we check the properties of each of them. Parameters of our machine are shown below on the screenshots.

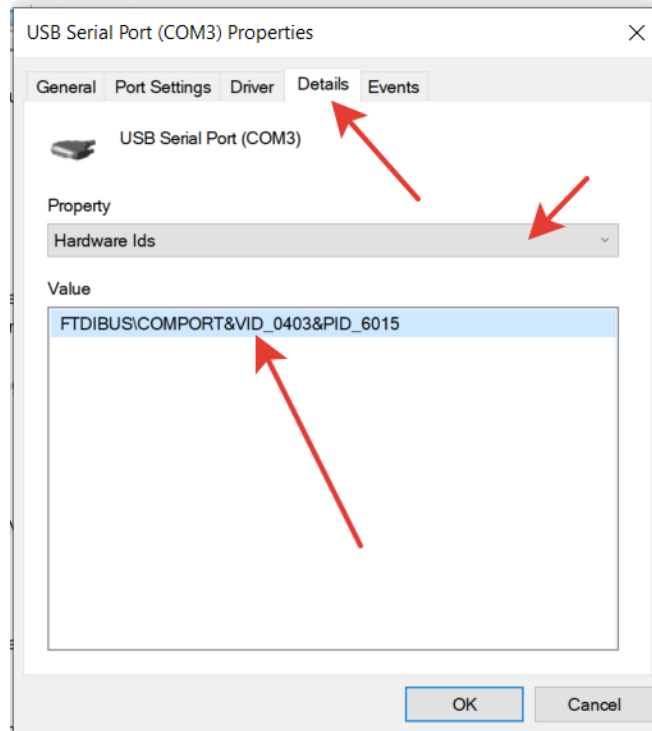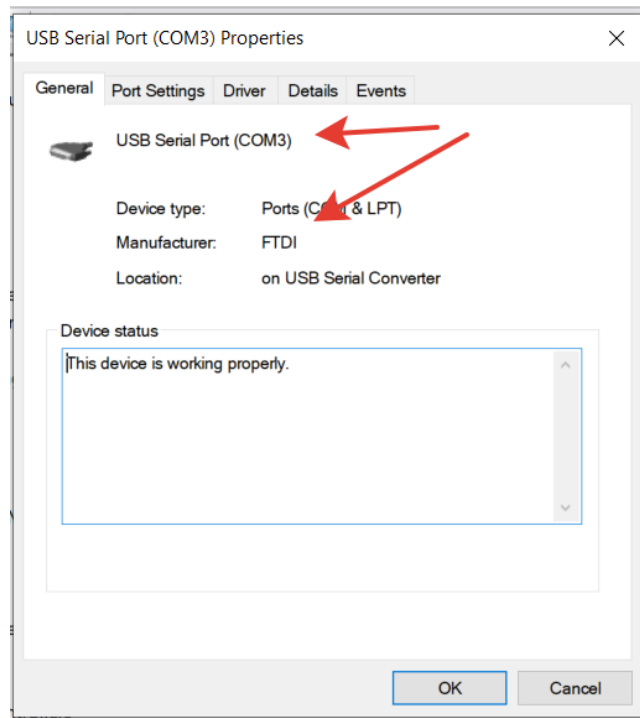

4. If everything is correct and the device is found, the configuration of the drive is finished. We disconnect the machine from the computer.